

Beechcraft A36, Failed Strobe Light Switch, ATA 3340

Another mechanic writes about the same switch discussed in the article regarding Failed Landing Light Switch, ATA 3340. "During a routine inspection, it was noted the strobe lights would remain on after the switch was selected 'off'. Troubleshooting revealed the switch to be defective. Once replaced (per AD2008-13-17), the *(original)* switch was disassembled. *(I observed)* the solder joint holding the braided wire broke, and welded itself to the line post." *(Switch P/N: 35-380132-103. The SDRS database reflects this switch 74 times.)*

Part Total Time: 516.0 hours