



Gulfstream G200, Burned Lavatory Electrical Connector, ATA 3897

An electrical technician states, "While troubleshooting the flight phone (1) found the lavatory plug (number) 548 P2 showing signs of discoloration and overheat. I capped and stowed the wires for 548 P2 IAW WDM 20-00-00. I collared (blocked) the circuit breakers for the lavatory water heater, the ribbon heater, the water system control, and the toilet—and verified no power at plugs 548 P2 and J2."

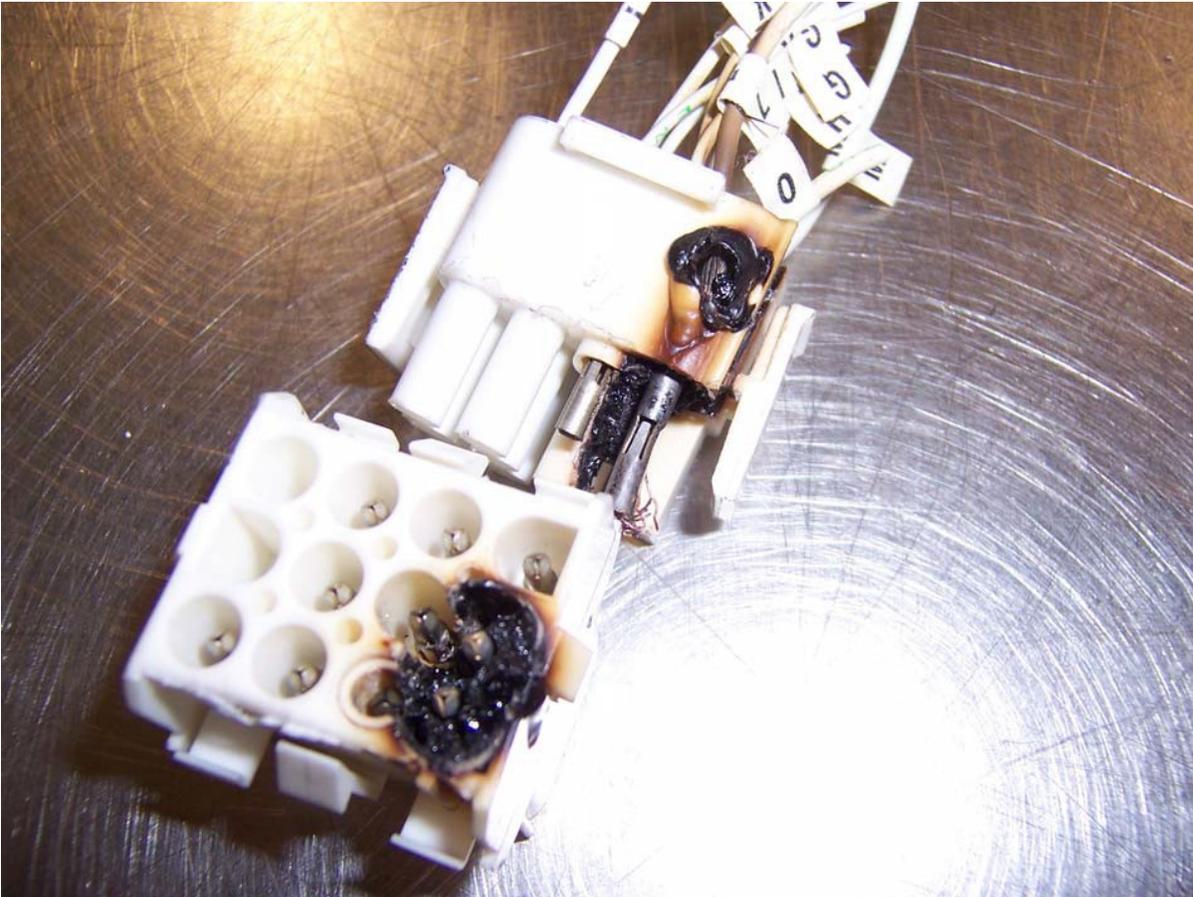

Gulfstream G200, Burned Lavatory Electrical Connector, ATA 3897

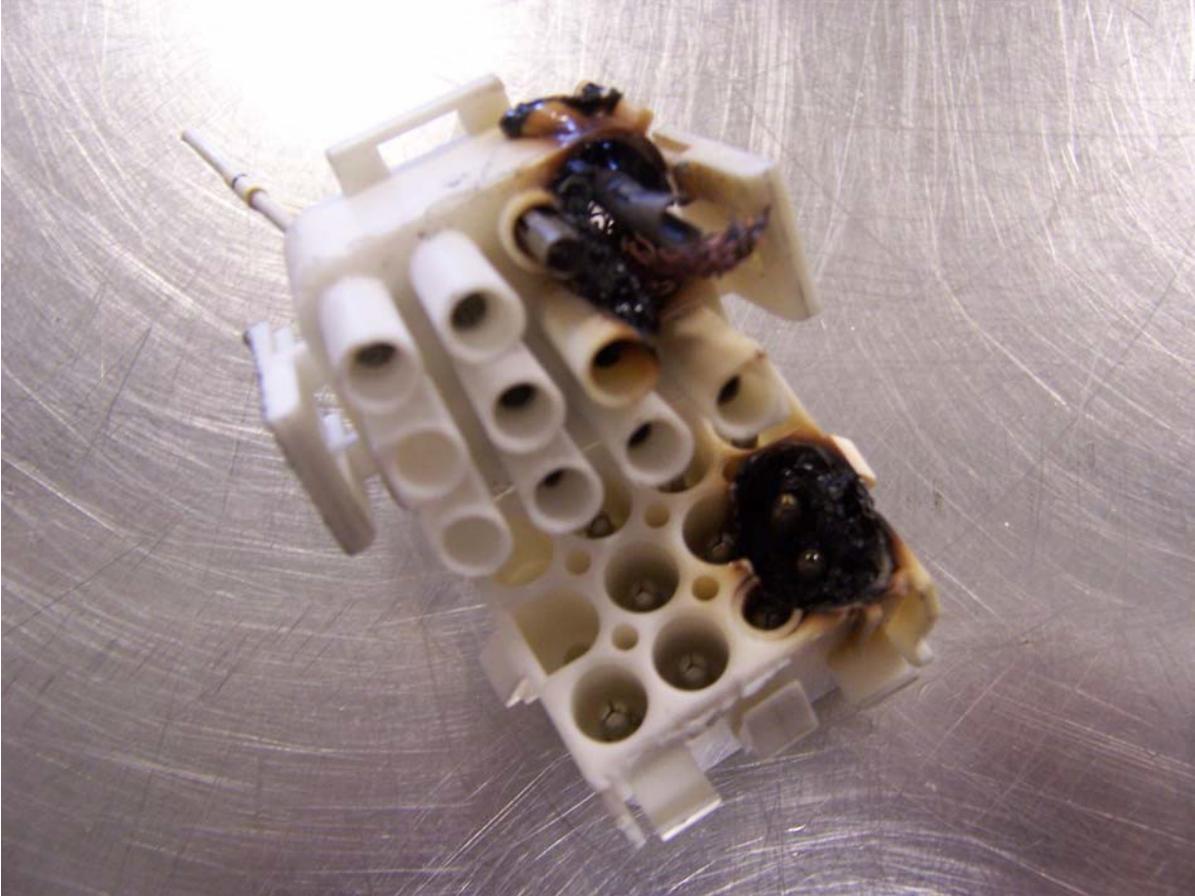

Part Total Time: 2,869.0 Hours