


Piper PA44_180, Cracked Nacelle Angles, ATA 5413

"During a scheduled inspection, a crack was found in the nacelle angle," states this mechanic. "Upon further investigation the crack was found to run between the two rivets that extend through the wing skin into the cap (P/N: 67097-002 or -003), which is attached to a web (P/N 67079-000 or 001). This web is where the main gear aft attach point is mounted.

The mechanic suspects this failure is caused by fatigue."

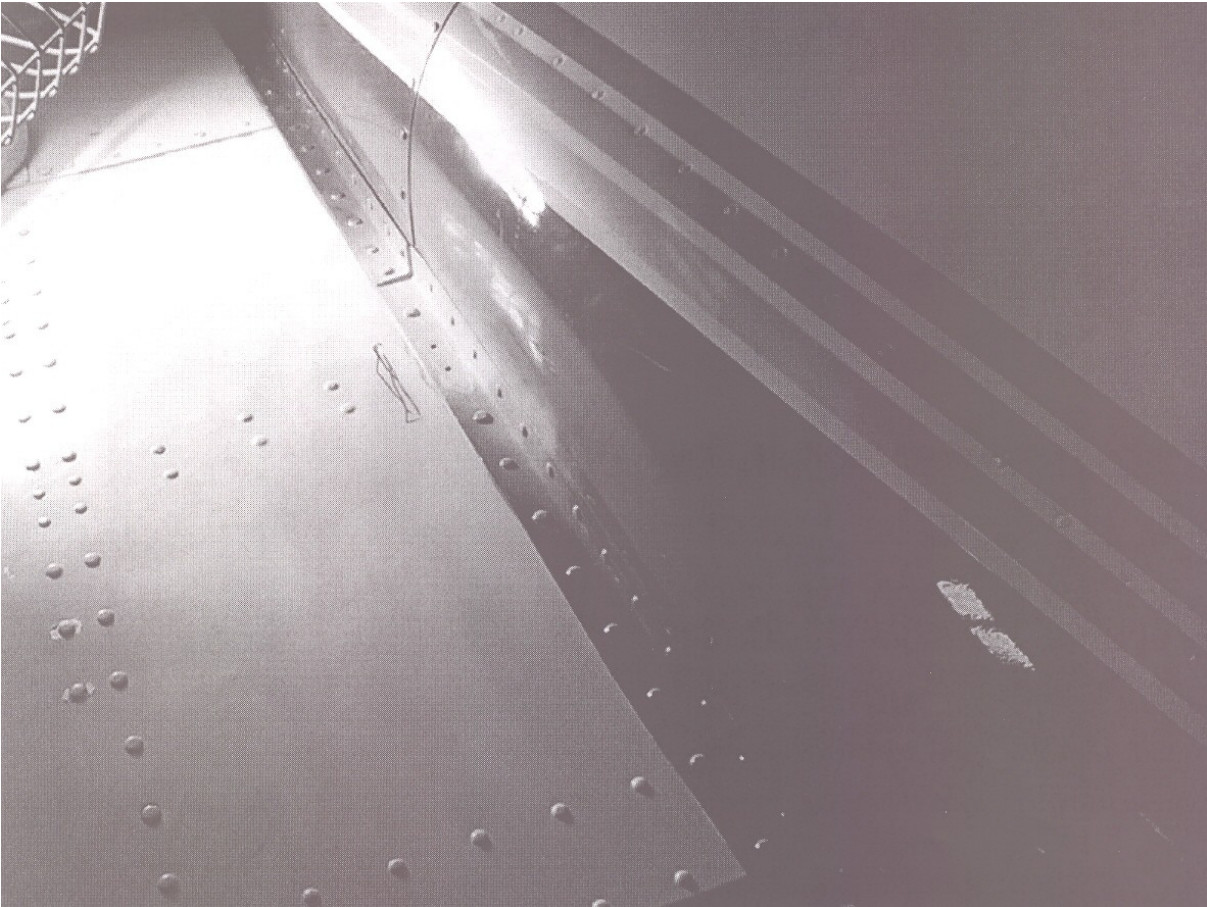

Piper PA44_180, Cracked Nacelle Angles, ATA 5413

