
ARIZONA

| TOMBSTONE MUNI (P29) P 3 SE UTC-7 N31°40.28' W110°01.29 4733 NOTAM FILE PRC RWY 06-24: H4430X60 (ASPH) 1.0% up SW | Y PHOENIX L-5C |
|---|-------------------------|
| RWY 06: Brush. RWY 24: Brush. AIRPORT REMARKS: Unattended. Gate combination 3214. Numerous trees and bushes between 1 and 15' in height within primary surface. Rwy 06–24 has 2–4 ft vegetation alg both sides of rwy. AIRPORT MANAGER: 520-235-5843 COMMUNICATIONS: CTAF 122.9 CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861. | |
| TUBA CITY (TØ3) 5 W UTC-7 N36°05.56´W111°22.99´ 4513 B NOTAM FILE PRC RWY15-33: H6230X75 (ASPH) S-12.5 MIRL | LAS VEGAS H-4j, L-8g |
| RWY 15: VASI(V2L)—GA 3.0° TCH 40′. | |
| SERVICE: LGTACTIVATE MIRL Rwy 15–33, VASI Rwy 15 and Rwy 33—CTAF. | |
| AIRPORT REMARKS: Unattended. Livestock on airport. Arpt access by calling security department at 928–283–2501. Gate code: 4513. | y tar |
| AIRPORT MANAGER: (505) 728-2804 | ľ, |
| COMMUNICATIONS: CTAF 122.9 | O |
| RC0 122.05R 113.5T (PRESCOTT RADIO) | \$230 |
| RADIO AIDS TO NAVIGATION: NOTAM FILE PRC. | 徐 ×7 |
| (H) VORTAC 113.5 TBC Chan 82 N36°07.28' W111°16.18' 238° 5.8 NM to fld. 5045/15E. | |

TUCSON

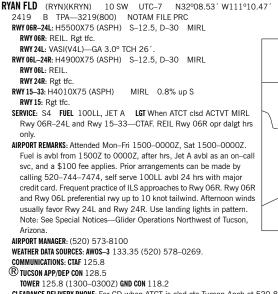

CLEARANCE DELIVERY PHONE: For CD when ATCT is clsd ctc Tucson Apch at 520-829-6121.


CONTINUED ON NEXT PAGE

PHOENIX H—4j, L—5C IAP. AD

77

ARIZONA

CONTINUED FROM PRECEDING PAGE

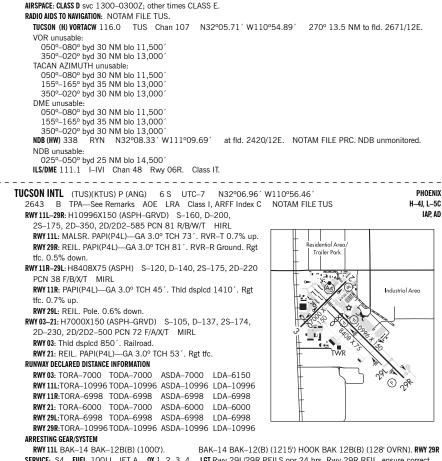

SERVICE: S4 FUEL 100LL, JET A 0X 1, 2, 3, 4 LGT Rwy 29L/29R REILS opr 24 hrs. Rwy 29R REIL, ensure correct lineup. Rwy 29L is the shorter rwy south of Rwy 29R. MILITARY—A-GEAR BAK-14/BAK-12B apch end Rwy 11L and BAK-14/BAK-12B apch end Rwy 29R, engagements avb only dur ANG duty hr and 15 min PN rqr. JASU 1(C-26) 1(MD-3) 9(M32A-60) FUEL A++, A (avbI 1300-0500Z, OT 2 hr PN \$50 fee, C520-889-0593.) (NC-100LL) FLUID PRESAIR LPOX LOX OIL 0-133-156(Mil)

AIRPORT REMARKS: Attended continuously. Hvy migratory bird act (Phase II) 1 July—31 Aug may pose a potential haz to acft. Air carriers use Rwy 11L-29R and Rwy 03–21. Acft depg Rwy 11R reqd to attain at least 400 ft AGL prior to starting turn. Rwy 29 approaches: Do not mistake Twy A for a landing surface. Twy A is North and parallel to Rwy 29R. No flight training 0500–1300Z except PPR, call airside opr department 520–573–8190. Air Natl Guard afld mgmt pers do not determine/rpt a RwyCC nor issue FAA formatted fld cond NOTAM (FICON). Rwy 11L–29R has dstc remaining markers on NE side. Rwy 03–21 has dstc remaining markers on SE side. All acft use upper antenna until airborne. TPA—3443 (800) small acft, 4043 (1400) large/heavy turbojet acft. Design group V acft taxi with inboard engines only. PPR required for all charter, sports team, cargo and military acft. No fil trng 0500–12002‡ excp PPR, call airside operations dept 520–573–8190. Rwy 11R–29L not avbl for sked acr opns with more than 9 psgr seats. Ldg and parking fees may apply for acft 12,500 lbs and up. No refueling on USCBP inspections ramp except during medical emergencies. Portions of Twy D not visible from twr due to hangars. Twy A5 limited to 70,000 lbs or less. For general questions call airport communications center 520–573–8182. Review hot spot info on airport diagram. Flight Notification Service (ADCUS) avbl. NOTE: See Special Notices—Glider Operations Northwest of Tucson, Arizona.

CONTINUED ON NEXT PAGE